P-021

Police Modifier Bulletin

SVE BULLETIN

SPECIAL VEHICLE ENGINEERING – BODY BUILDERS ADVISORY SERVICE

E-Mail via website: www.fleet.ford.com/truckbbas (click "Contact Us")

Toll-free: (877) 840-4338

Date: 9 September, 2014

Utility Police Interceptor with Side Marker LED – Sideview Mirror LED Lights Option (63B)

Models Affected
Some 2014MY and 2015MY Utility Interceptors ordered with Side Marker LED – Sideview Mirror LED Lights Option 63B.

Purpose
Some 2014MY and 2015MY Utility Police Interceptors may have been ordered without a wire harness option that would provide the circuits to power the Mirror LED lights.

This bulletin provides wiring suggestion to complete circuits for the mirror LED light option on Utility Police Interceptors ordered without the wiring to complete the circuits to operate the Mirror LED lights.

Vehicle Orders Placed with Mirror LED Light Option
Effective 8/27/14, orders placed with option: **Side Marker LED – Sideview Mirrors (63B)** now require the Pre-Wiring for Grille, Siren and Speaker (60A) if the following options were not ordered:

66A - Front Headlamp Lighting Solution
67G - Cargo Wiring Upfit Package
67H - Ready for the Road
67U - Ultimate Wiring Package

Vehicles with Option 63B that do not have the wire harness to complete the circuit for Mirror LED lights see diagram on page 2 of 2 in this document.

When modifying electrical circuits, refer to guidelines in Section 2 of the Modifier Guide

Adhere to guidelines for disconnecting power for personal safety and protection of electrical/electronic components

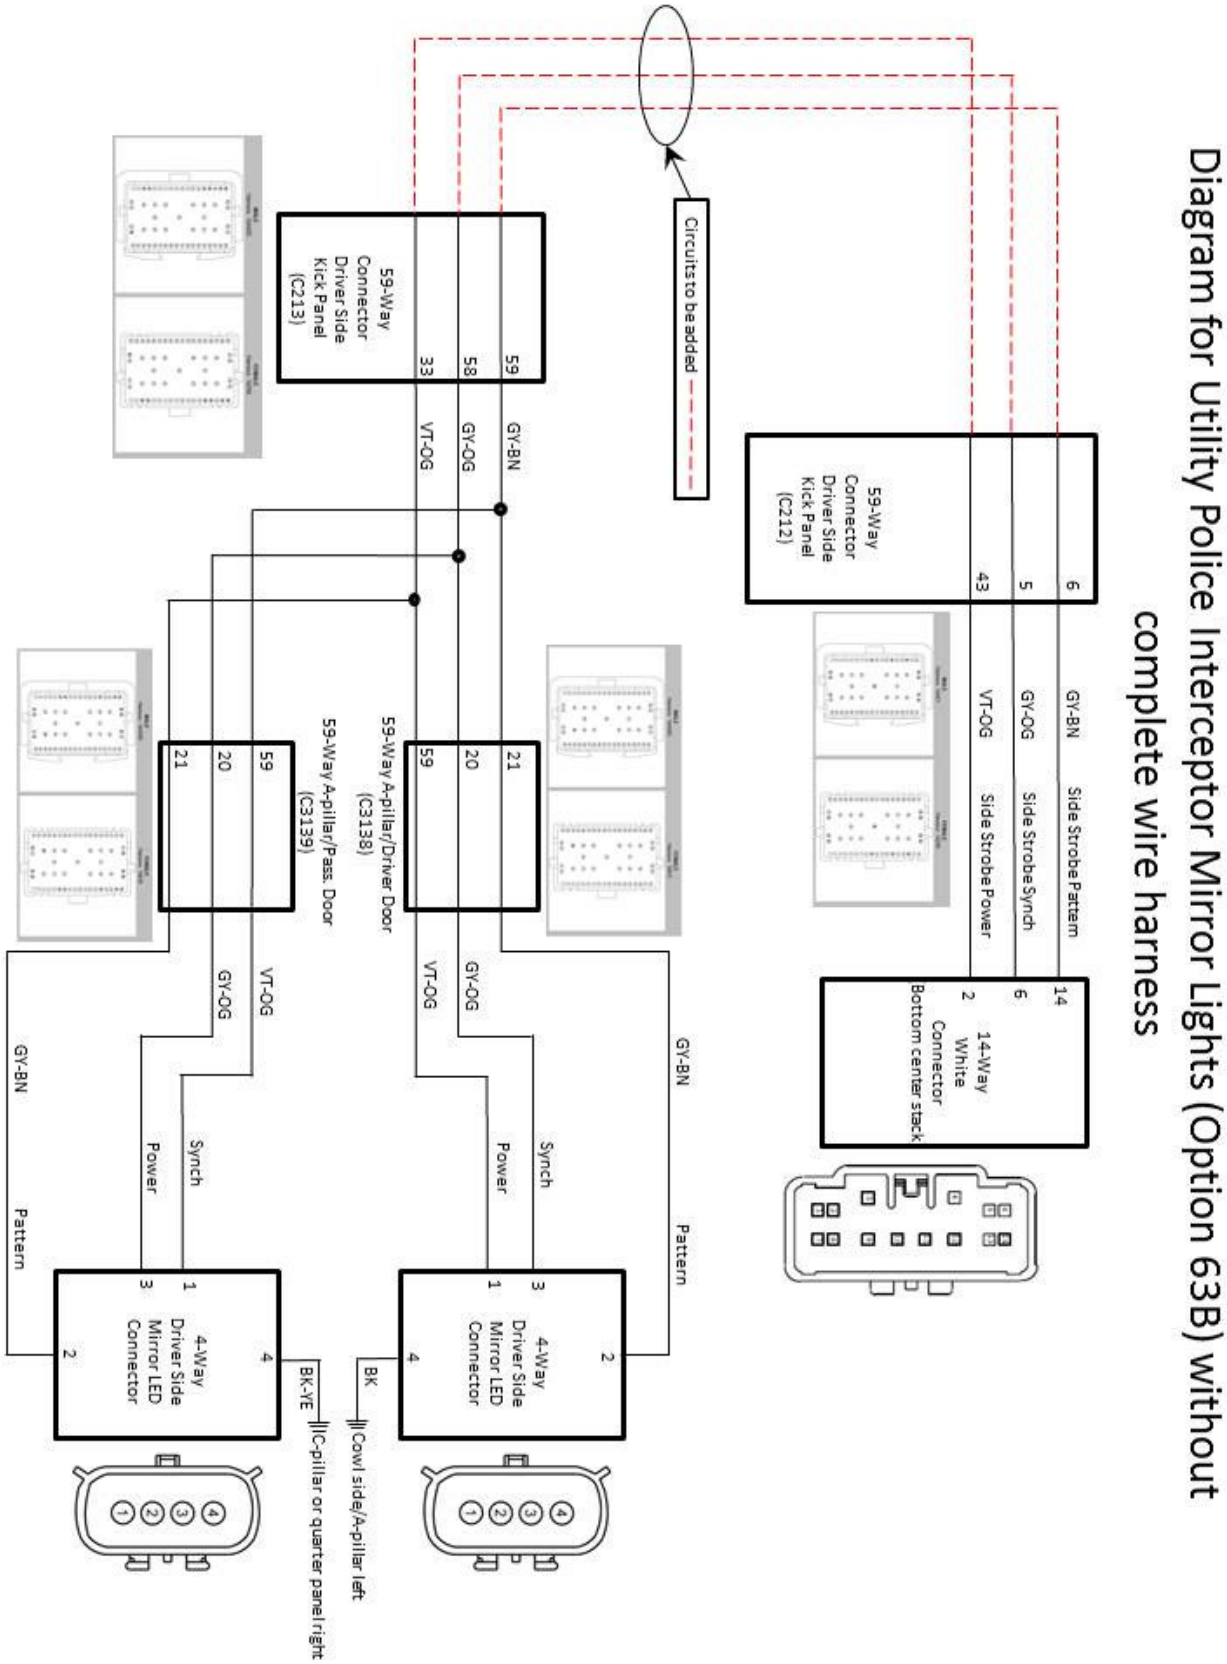

If you have any questions, please contact the Ford Truck Body Builders Advisory Service as shown in the header of this bulletin.